

(Model 8170-9001 replaces 8170 and 8170F)

DESIGN FEATURES

Body: Bronze
Impeller: Neoprene
Shaft: Stainless Steel
Bearings: Ball Bearing
Ports: 3/4" I.P.T.

SERVICE KITS

MINOR SERVICE KIT—For "onboard" repairs—includes impeller, seal and gasket.

MAJOR SERVICE KIT—For major pump overhaul includes all parts except body.


APPLICATION: Marine engine cooling for Chrysler marine engines series M-46-4, M-47-4.

OPERATING INSTRUCTIONS

- INSTALLATION—Care should be taken that the intake and discharge piping of the engine corresponds with the port as shown on the installation drawing.
- 2. DRIVE-Direct.
- SPEEDS—Pump is designed to operate through the entire engine range.
- SELF-PRIMING—Jabsco Pumps will operate satisfactorily at low as well as high speeds. Be sure suction lines are airtight.
- RUNNING DRY-Impeller depends on liquid pumped for lubrication. DO NOT RUN DRY for more than 30 seconds. Lack of liquid will burn the impeller.
- PRESSURES—Excessive back pressure due to scale and rust deposits in the water passages will reduce the flow and cause engine to overheat.
- TEMPERATURES—Impeller specially compounded to operate through the range of 45° - 180° F. For temperatures of 27° - 45° F. use -09 impeller.

- FREEZING WEATHER—Drain unit by loosening end cover plate. For closed systems, use one of the following anti-freeze compounds: Atlas "Permaguard", DuPont "Zerex", Dow Chemical "Dowguard", "Pyro", or "Telar". Do not use petroleum based anti-freeze compounds.
- IMPELLER REPLACEMENT—Remove end cover. Withdraw impeller by grasping impeller hub with pliers.
- GASKET REPLACEMENT—Always use standard pump part. A thicker gasket will reduce priming ability. A thinner gasket will cause impeller binding.
- CAM REPLACEMENT—Coat top surface of new cam and cam screw threads with permatex #1 or equivalent sealing compound before installing.
- SPARE PARTS—Avoid costly shut downs by always having a JABSCO Service Kit on hand.

JABSCO PRODUCTS III

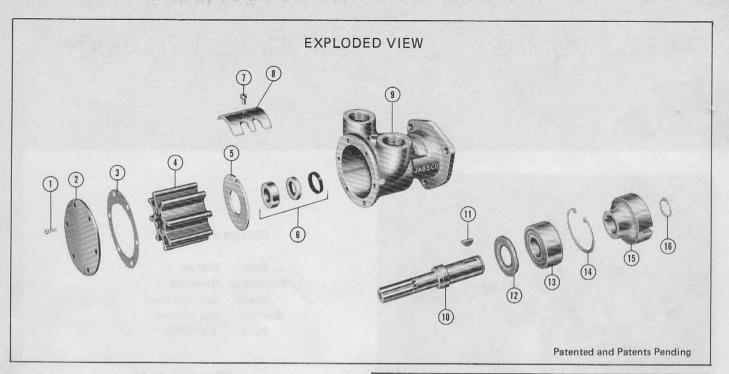

PARTS LIST


KEY	PART NO.	QTY. REQ'D.	DESCRIPTION
1	91003-0010	6	End Cover Screw
2	8175-0010	1	End Cover
3	3101-0000	1	*Gasket
4	920-0001	1	*Impeller
5	4156-0000	1	Wearplate
6	96080-0080	1	*Seal
7	91004-0110	1	Cam Screw
8	3255-0000	1	Cam
9	8174-9000	1	Body
10	8177-0410	1	Shaft
11	91402-0060	1	Key
12	913-0000	1	Bearing Seal
13	92600-0060	1	Ball Bearing
14	91701-1850	1	Retaining Ring
15	8176-0000	1	Coupling
16	91700-2470	1	Retaining Ring

90118-0001 Service Kit contains parts marked with asterisk.

Model 81-70 Lip Seal Version (obsolete)

92700-0060 - Seal 92000-0210 - 'O' Ring 3166 - Spacer 3298 - Slinger

Face seal cannot be installed in lip seal version.

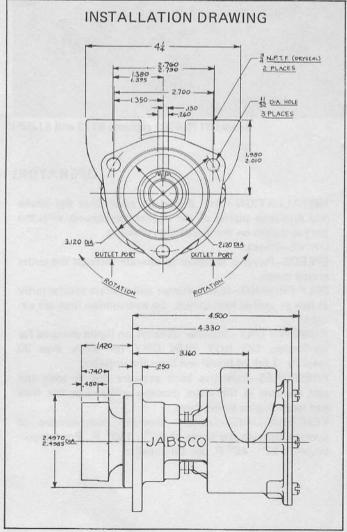

JABSCO PRODUCTS ITI

Marine and Recreation Components Division International Telephone and Telegraph Corporation 1485 Dale Way, Costa Mesa, California 92626

Telephone: (714) 545-8251